Microcomputer Technical Information

CP(K) O

| | | | | 01 [| N), U |
|---|--------------------|----------------|---|-------------------------|----------|
| | | Document No. | ZBG | -CD-05-0025 | 1/2 |
| IE-789234-NS-EM1 | | Date issued | March 28, 2005 | | |
| In-Circuit Emulator for | | Issued by | Development Tool Group | | |
| 78K0S/KY1+, 78K0S/KA1+, 78K0S/KB1+ | | | Multipurpose Microcomputer Systems Divisior | | Division |
| | | | 4th S | Systems Operations Unit | |
| | Usage Restrictions | | NEC Electronics Corporation | | |
| Related IE-789234-NS-EM1 User's Manual: | | Notification | | Usage restriction | |
| documents | ZUD-CD-05-0037 | classification | | Upgrade | |
| | | | | Document modification | |
| | | | | Other notification | |

1. Affected product

IE-789234-NS-EM1

Control code^{Note}: A, B

2. Details of restrictions

The following restrictions have been added. See the attachment for details.

- No. 3 Bug in A/D function
- No. 4 Bug in P121/X1 pin
- No. 5 Debugger hangs up after execution of STOP instruction
- 3. Workarounds

The following workarounds are available for these restrictions. See the attachment for details.

- No. 3 Stop the A/D converter operation (ADCS = 0) then change the settings of ADS or ADM.
- No. 4 When using the P121/X1 pin as an external clock input pin, do not set bit 1 of PM12 to select output mode.
- No. 5 Be sure to set the interrupt enable flag to 1 (El instruction) before executing a STOP instruction. Moreover, do not execute an instruction that holds interrupt requests pending immediately before executing the STOP instruction.
- 4. Modification schedule

Products in which No. 3 to No. 5 are corrected are scheduled for release as follows. Newly shipped products: From the shipment of June 2005 (Control code: C) Upgrade for already shipped products: Available from June 2005

* Note that this schedule is subject to change without notice. For the detailed release schedule of modified products, contact an NEC Electronics sales representative.

Note The "control code" is the second digit from the left in the 10-digit serial number in the warranty supplied with the product you purchased. If the product has been upgraded, a label indicating the new version is attached to the product and the x in V-UP LEVEL x on this label indicates the control code.

5. List of restrictions

See the attachment.

6. Document revision history

IE-789234-NS-EM1 In-Circuit Emulator for 78K0S/KY1+, 78K0S/KA1+, 78K0S/KB1+ Usage Restrictions

| Document Number | Issued on | Description | |
|-----------------|----------------|---|--|
| ZBG-CD-05-0025 | March 28, 2005 | 1st edition (target control code: A, B) | |
| | | Addition of new bugs (No. 3 to No. 5) | |

Notes on Using IE-789234-NS-EM1

1. Product Version

Part number: IE-789234-NS-EM1

| Control Code ^{Note} | Remark |
|------------------------------|--------|
| А | _ |
| В | - |

Note The "control code" is the second digit from the left in the 10-digit serial number. If the product has been upgraded, a label indicating the new version is attached to the product and the x in V-UP LEVEL x on this label indicates the control code.

2. Product History

| No. | Bugs and Changes/Additions to Specifications | | Control Code ^{Note} | |
|-----|---|----------|------------------------------|--|
| | | А | В | |
| 1 | Restriction on oscillation stabilization time | Permanen | t restriction | |
| 2 | Addition of target devices | _ | \checkmark | |
| 3 | Bug in A/D function | × | × | |
| 4 | Bug in P121/X1 pin | × | × | |
| 5 | Debugger hangs up after execution of STOP instruction | × | × | |

 \times : Applicable, $\sqrt{}$: Not applicable (specifications added), –: Specification change not implemented

3. Details of Bugs and Added Specifications

No. 1 Restriction on oscillation stabilization time

[Description]

When the IE-789234-NS-EM1 is used in combination with the IE-78K0S-NS, the emulator may not be activated depending on the combination of the oscillation stabilization time and the frequency of the clock supplied to X1 set by the option byte, as shown below.

This restriction does not apply when the IE-789234-NS-EM1 is used in combination with IE-78K0S-NS-A.

| Option Byte Setting | | Oscillation | | |
|---------------------|----------|---------------------|--------------------------------------|--------------------------------|
| SW3-7 | SW3-6 | Stabilization Time | Frequency of Clock Supplied to X1 | Result |
| DEFOSTS1 | DEFOSTS0 | | | |
| 0 | 0 | 2 ¹⁰ /fx | 500 kHz to 10 MHz | ОК |
| 0 | 1 | 2 ¹² /fx | 500 kHz to 10 MHz | ОК |
| 1 | 0 | 2 ¹⁵ /fx | 500 kHz to 10 MHz | May not be activated when the |
| | | | | frequency is lower than 1 MHz. |
| 1 | 1 | 2 ¹⁷ /fx | 500 kHz to 10 MHz | May not be activated when the |
| | | | | frequency is lower than 2 MHz. |

ZBG-CD-05-0025 Attachment - 2/6

[Workaround]

Regard this item as a permanent restriction.

Use the IE-789234-NS-EM1 as shown below when it is used in combination with the IE-78K0S-NS.

- Supply a 1 MHz or higher clock to X1 when the oscillation stabilization time is set to 2¹⁵/fx (DEFOSTS1: 1 and DEFOSTS0: 0).
- Supply a 2 MHz or higher clock to X1 when the oscillation stabilization time is set to 2¹⁷/fx (DEFOSTS1: 1 and DEFOSTS0: 1).

No. 2 Addition of target devices

[Description]

The target devices shown below are now supported in IE-789234-NS-EM1 control code B. (IE-789234-NS-EM1 control code A only supports 78K0S/KA1+: μ PD78F9221, μ PD78F9222)

- 78K0S/KY1+: μPD78F9210, μPD78F9211, μPD78F9212
- 78K0S/KB1+: μPD78F9232, μPD78F9234

No. 3 Bug in A/D function

[Description]

The A/D function may not operate if any of the following operations is performed while the use environment temperature is low.

- Changing the settings of analog input channel specification register (ADS) during A/D conversion

- Changing the settings of A/D converter mode register (ADM) during A/D conversion

[Workaround]

Stop the A/D converter operation (ADCS = 0) then change the settings of ADS or ADM. This bug will be corrected in IE-789234-NS-EM1 with control code C or later.

No. 4 Bug in P121/X1 pin (target devices: 78K0S/KA1+, 78K0S/KB1+)

[Description]

When the P121/X1 pin is used as an external clock input pin, the P121/X1 pin does not function as the I/O port. However, it functions as an output port if bit 1 of port mode register 12 (PM12) is set to select output mode.

[Workaround]

When using the P121/X1 pin as an external clock input pin, do not set bit 1 of PM12 to select output mode.

This bug will be corrected in IE-789234-NS-EM1 with control code C or later.

No. 5 Debugger hangs up after execution of STOP instruction

[Description]

Regarding the standby release conditions after a STOP instruction is executed, if an arbitrary interrupt mask flag is cleared to 0 while an interrupt enable flag is 0 (by executing the DI instruction), an interrupt is generated (interrupt request flag = 1), then the STOP instruction is executed, the standby state is not released and the debugger hangs up. Moreover, the standby state is not released even if a standby release signal is generated due to another interrupt request, and the debugger hangs up.

Example 1 A standby release signal is generated due to INTP0 immediately before executing a STOP instruction while interrupts are disabled

| DI | ; Disables interrupts |
|-----------|--|
| SET1 PIF0 | ; Sets INTP0 interrupt request flag |
| CLR1 PMK0 | ; Clears masking of INTP0 interrupt |
| SET1 P2.0 | ; Sets port 20 to "1" |
| STOP | ; Enters STOP mode |
| CLR1 P2.0 | ; Clears port 20 to "0" (not executed) |
| | |

The same situation occurs when a standby release signal is generated while interrupts are enabled and an instruction that holds interrupt requests pending is executed immediately before a STOP instruction.

Example 2 A standby release signal is generated due to INTP0 immediately before executing a

| EI | ; Enables interrupts |
|-----------|---|
| SET1 P2.0 | ; Sets port 20 to "1" |
| SET1 PIF0 | ; Sets interrupt request flag |
| CLR1 PMK0 | ; Executes an instruction that holds interrupt requests pending |
| | ; immediately before executing a STOP instruction |
| STOP | ; Enters STOP mode |
| CLR1 P2.0 | ; Clears port 20 to "0" (not executed) |

STOP instruction while interrupts are enabled

Remark Instructions that hold interrupt requests pending

- Instructions that perform writing to the interrupt request flag register (IF0 or IF1)

- Instructions that perform writing to the interrupt mask flag register (MK0 or MK1)

[Workaround]

Be sure to set the interrupt enable flag to 1 (EI instruction) before executing a STOP instruction. Moreover, do not execute an instruction that holds interrupt requests pending immediately before executing the STOP instruction.

Example Execute an El instruction immediately before executing the STOP instruction

| DI | ; Disables interrupts |
|-----------|-------------------------------------|
| SET1 PIF0 | ; Sets INTP0 interrupt request flag |
| CLR1 PMK0 | ; Clears masking of INTP0 interrupt |
| SET1 P2.0 | ; Sets port 20 to "1" |
| EI | ; Enables interrupts |
| STOP | ; Enters STOP mode |
| CLR1 P2.0 | ; Clears port 20 to "0" (executed) |

Remark In the case that an interrupt occurs immediately before a STOP instruction, the interrupt request flag is cleared before executing the STOP instruction. To release the STOP mode, therefore, another interrupt must be generated.

This bug will be corrected in IE-789234-NS-EM1 with control code C or later.

4. Cautions

- Since the IE-789234-NS-EM1 sets the option byte using SW3, the value set to address 80H is not reflected.
- (2) Some bits of the port register are fixed to 0 in the target device, but some of them can be overwritten by program. However, writing is not possible on the SFR window.
- (3) A/D conversion can be started without waiting for 1 μ s or longer even if bit 0 (ADCE) of the A/D converter mode register (ADM) is set to 1.
- (4) Bit 4 (WDTRF) and bit 0 (LVIRF) of the reset control flag register (RESF) cannot be initialized by the reset button of the debugger or reset button (SW2) of the IE-78K0S-NS and IE-78K0S-NS-A. Input a reset from the target side, re-apply power to the emulator, or press SW4 on the IE-789234-NS-EM1.
- (5) The IE-789234-NS-EM1 does not support the self-programming function of the flash memory.
- (6) When HALT mode is released by an interrupt, the program is restored two or three clocks earlier than the target device.

(7) Low-voltage detection level

An error of several mV occurs in the IE-789234-NS-EM1 compared to the target device.

(8) A/D converter characteristics

The characteristics of the A/D converter of the IE-789234-NS-EM1 differ from those of the target device because a probe is connected between the IE-789234-NS-EM1 and the target system.

(9) 8-bit timer H1

When the low-speed Ring-OSC is selected as the 8-bit timer count clock, the timer does not stop while the program is stopped even if "Break" is selected for "Peripheral Break" in the Configuration dialog box of the debugger.

(10) RESET pin

Since the RESET pin alternately functions as P34, it is connected to a protective resistor (pull-down resistor) inside the emulator. Consequently, the RESET pin is always at low level.

Normally a reset does not occur because "Mask: RESET" is set in the Configuration dialog box, but if the "Mask: RESET" setting is cancelled, a reset is always applied, which causes the debugger to hang up.

When inputting an external reset from the RESET pin, first pull the RESET pin up and cancel the "Mask: RESET" setting in the Configuration dialog box.

- (11) General cautions on handling this product
 - (11)-1. Circumstances not covered by product guarantee
 - If the product was disassembled, altered, or repaired by the customer
 - If it was dropped, broken, or given another strong shock
 - Use at overvoltage, use outside guaranteed temperature range, storing outside guaranteed temperature range
 - If power was turned on while the power supply unit, PC interface cable, or target system connection was in an unsatisfactory state
 - If the power supply cable, PC interface cable, emulation probe, or the like was bent or pulled excessively
 - If a power supply unit other than the one supplied with the product is used
 - If the product got wet
 - If the product and target system were connected while a potential difference existed between the GND of the product and the GND of the target system
 - If a connector or cable was removed while the power was being supplied to the product
 - If an excessive load was placed on a connector or socket

(11)-2. Safety precautions

- If used for a long time, the product may become hot (50°C to 60°C). Be careful of low temperature burns and other dangers due to the product becoming hot.
- Be careful of electrical shock. There is a danger of electrical shock if the product is used as described above in (11)-1 Circumstances not covered by product guarantee.
- (12) Caution on connecting emulation probe

When using IE-789234-NS-EM1 control code B or later, do not connect the emulation probe directly to probe connector CN5. Refer to the user's manual included with a control code B or later product or the latest user's manual for the probe interface conversion board corresponding to the target device and connect the emulation probe via this board.

| Target Device | Probe Interface Conversion Board | Emulation Probe |
|------------------------------------|----------------------------------|-----------------|
| 78K0S/KA1+: μPD78F9221, μPD78F9222 | 789222 PROBE Board | NP-30MC |
| 78K0S/KB1+: μPD78F9232, μPD78F9234 | 789234 PROBE Board | |

(13) Caution on device file version

When using IE-789234-NS-EM1 control code B or later, do not use device file DF789222 V1.10, which is designed for IE-789234-NS-EM1 control code A.

The device file can be downloaded from the NEC Electronics website.

(URL: http://www.necel.com/micro/)

| Target Device | Control Code | Usable Device File |
|------------------------------------|--------------|--------------------|
| 78K0S/KA1+: μPD78F9221, μPD78F9222 | А | DF789222 V1.10 |
| | В | DF789222 V2.00 |