

TSOP (1)
Mount Pad Dimensions

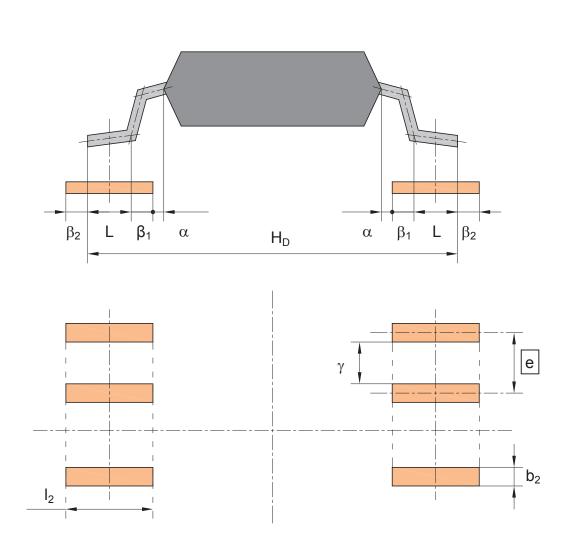

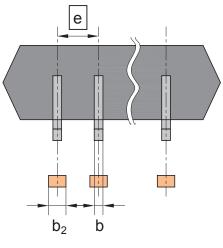

$$I_2 = L + \beta_1 + \beta_2$$

$$b \le b_2 \le e - \gamma$$

l₂ and b₂ can get by following formula and value e and b from package drawing figure and below parameter table.

• Dimension parameter

(Unit: mm)

е	0.65	0.55	0.50	0.40
α	0.05 to 0.10	←	←	←
β_1	0.20 to 0.25	←	←	←
β_2	0.20 to 0.40	←	←	←
γ	0.30	0.25	0.25	0.20

(Reference values based on the former EIAJ ED-7402 standard)